

# TriCast 50 Epoxy Resin System Technical Data Sheet

## **Product Description**

The TriCast 50 is a two component Epoxy Casting Resin System with high transparency suitable for deep castings.

Component A is an epoxy resin, unfilled, bluish-transparent.

Component B is amine, unfilled, transparent.

#### **Applications**

This Epoxy Resin is perfect for creating furniture, art and decorative projects that require deep, transparent pours. It is also suitable for UV resistant castings such as river resin tables, embeddings, trophies and mock-ups.

### **Resin Properties**


- High transparency
- Low viscosity
- Self-degassing behaviour
- Single pour casting up to 50 mm
- Good UV resistance

## **Physical Properties**


		Resin A	Hardener B
Components		TriCast 50	TriCast 50
Viscosity, 25 °C	mPa.s	~ 600	~ 100
Mixing ratio	In parts by weight	100	45
	In parts by volume	100	50
		Mixture	
Colour		Transparent	
Viscosity, 25 °C	mPa.s	~ 300	
Reactivity on 500 g, 23 °C* (Max. exothermic temperature)	h °C	~ 17 ~ 35	

<sup>\*</sup> refer to the graph below, influence of room temperature (RT) on exothermic reaction and curing time on 500 g casted in a plastic cup in thickness 90 mm

TriCast 50 Epoxy Resin System
Reactivity and exothermicity vs room temperature

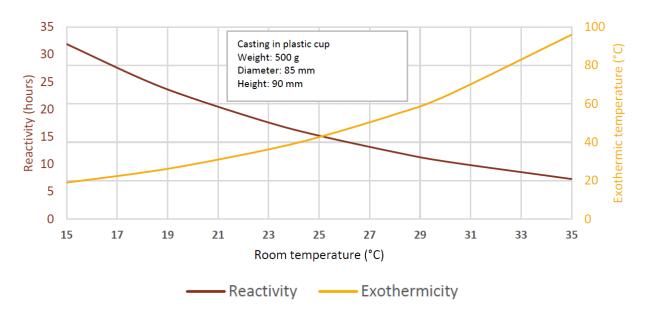

TriCast 50 Epoxy Resin System Reactivity vs time & temperature

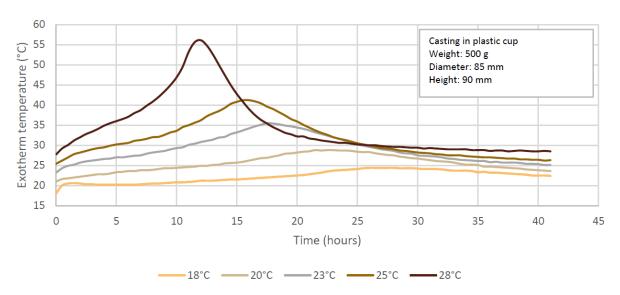

#### **Mechanical and Thermal Properties**

approx. values on standard-sized specimen / after curing 7 days at room temperature

Shore hardness	ISO 868	Shore D1	D 80
Elongation at maximum strength	ISO 527	%	4,5
Flexural modulus	ISO 178	MPa	2,100
Glass transition temperature (TG)	ISO 11359-2	°C	39
Glass transition temperature (TG) after 16H at 50°C	ISO 11359-2	°C	47

## **Specific Properties**

Maximum casting thickness on plate 350 x 300 mm

Room temperature	Thickness (mm)	Weight (g)	Temperature of reaction
< 18 °C	100	11,550	>45°C
18 °C	70	8,085	45°C
20 °C	50	5,575	30°C
23 °C	25	2,890	27°C
25 °C	15	1,730	27°C
28 °C	10	1,155	30°C

## **Packaging Units**

- TriCast 50 Epoxy Resin System Component A: 1000 kg / 220 kg / 5 kg / 6 x 1.05 kg net
- TriCast 50 Epoxy Resin System Component B: 950 kg / 200 kg / 2.25 kg / 6 x 0.95 kg net

#### **Processing Data**

- Room temperature is the most important parameter to be successful in TriCast 50 Epoxy Resin System casting. There is a link in between room temperature (RT), volume of cast resin and curing speed. A speed curing caused by warm RT creates high exothermic reaction and cured resin could be yellow with streaks on top.
- Mixing should be done by hand or with an electric mixer. Be careful not to incorporate too much air while mixing. Emulsion must be avoided.
- After a primary mixing in a bucket pour the product in a second bucked and finish the mixing. Scrap
  well the walls of the mixing container. Leave the mixing for a self- degassing for at least 15 to 30
  minutes prior to cast or use a vacuum chamber.
- According to long pot life and low viscosity the casting frame must be perfectly tight. Brown PE
  packing tape is self-releasing from the resin and could be used in corners of the box and anywhere
  resin should not bond on support.
- A liquid or pasty wax could be also used to prevent bonding on models and supports. The wood or porous surfaces of models must be sealed before casting the resin. Quick setting epoxy or a varnish could be used but sealer must be cured prior to casting of TriCast 50 Epoxy Resin System.
- After casting and some relaxation time the remaining bubbles can easily be removed with a hot airstream gun (sweep the surface at 15-20 cm of distance).
- A thin sanding and polishing are almost always needed to get shiny and flat surface.
- Use appropriate tools in order to avoid heat on the resin when polishing. Water sandpaper is advised.

## **Storage Conditions**

#### Shelf life

- TriCast 50 Epoxy Resin System Component A: 12 months
- TriCast 50 Epoxy Resin System Component B: 12 months

## Storage temperature:

- TriCast 50 Epoxy Resin System Component A: 15 25°C
- TriCast 50 Epoxy Resin System Component B: 15 25°C

#### Crystallization

- After prolonged storage at low temperature, crystallization of A (RESIN) component may occur.
- This is easily removed by warming up for a sufficient time to a maximum of 70 °C.
- Allow to cool to requested processing temperature before use.

#### Opened packages

• Containers must be closed tightly immediately after use to prevent moisture ingress. The residual material needs to be used up as soon as possible.

#### **Further Information**

The information herein is offered for general guidance only. Advice on specific applications is available on request from the Technical Department of Sika Advanced Resins. Copies of the following publications are available on request: Safety Data Sheets

#### **Basis of Product Data**

All technical data stated in this document are based on laboratory tests. Actual measured data may vary due to circumstances beyond our control.

#### **Health and Safety Information**

For information and advice regarding transportation, handling, storage and disposal of chemical products, users shall refer to the actual Safety Data Sheets containing physical, ecological, toxicological and other safety-related data.

This information is provided in good faith and every reasonable effort is made to ensure that it is accurate and up to date. Tricel Composites (GB) Ltd. shall not be liable for any damage arising, directly or indirectly, from the use of the information contained herein. It is issued on the condition that the user will determine the safety and suitability of this product for their purpose prior to use. Regulations are country-specific and local information should be sought before placing your product on the market.